

---

The logo for Seabee Service News features the word "Seabee" in a large, bold, italicized font with a yellow and black striped background behind it. To the right of "Seabee" is a stylized illustration of a propeller. Below "Seabee" is the word "Service News" in a smaller, bold, italicized font.

---

REPUBLIC AVIATION CORPORATION  
FARMINGDALE, LONG ISLAND, NEW YORK  
SERVICE DEPARTMENT

---

January 28, 1947

DISTRIBUTORS BULLETIN No.27

---

SERVICE BULLETIN ANNOUNCEMENT

Subject: Service Bulletin No. 8 "Installation Tail Wheel Signal Light Switch".

Reason for Change:

This change is not imperative but is recommended in order to provide a switch on the tail wheel so that the landing gear green light will not go on unless both main gear and tail wheel are down and locked.

Airplanes Affected:

Republic Serial Nos. 5 thru 150 incl. Serial Nos. 151 and up have already had this change accomplished in production.

Description of Change:

This change involves removing existing ground jumper from the main gear down switch, installing wire from this switch to tail wheel mechanism and installing new switch at tail wheel.

Parts Required:

Parts required will be furnished in a kit. This kit may be ordered as spares item 1489 at a list price of \$5.00. Please advise serial numbers of airplanes for which kits are ordered.

Labor Required:

Approximately four manhours will be required to accomplish this change.

Bulletin Distribution:

Service Bulletin covering this change will be packed in the kit.

Kit Distribution:

Kits will be forwarded on receipt of orders.

W. H. Ehmann  
Service Manager