

SERVICE BULLETIN



REPUBLIC AVIATION CORPORATION
FARMINGDALE, LONG ISLAND, NEW YORK
SERVICE DEPARTMENT

Date Unknown

MANDATORY CHANGE

SERVICE BULLETIN NO. 9

REWORK OF STARTER TERMINAL JUNCTION COVER ASSEMBLY

Reason for Change: To prevent the possibility of a short circuit occurring if the cover becomes dented.

Airplanes Affected: Republic Serial Nos. 5 through 130 inclusive. Serial Nos. 131 and up have already had this change accomplished in production.

Description of Change: This change involves removing the starter terminal junction cover located forward on the firewall and bending it to give sufficient clearance; the rework shall be accomplished as follows:

NOTE: It is recommended that this change be accomplished the next time the engine side cowl is removed for any maintenance or inspection.

1. Remove top and right hand side cowl.
2. Remove starter terminal junction cover and rework as shown on Figure 1 by bending.
3. Replace junction cover, top and right hand side cowl and make suitable entry in log book.

Parts Required: None.

W. H. Ehmann
Service Manager

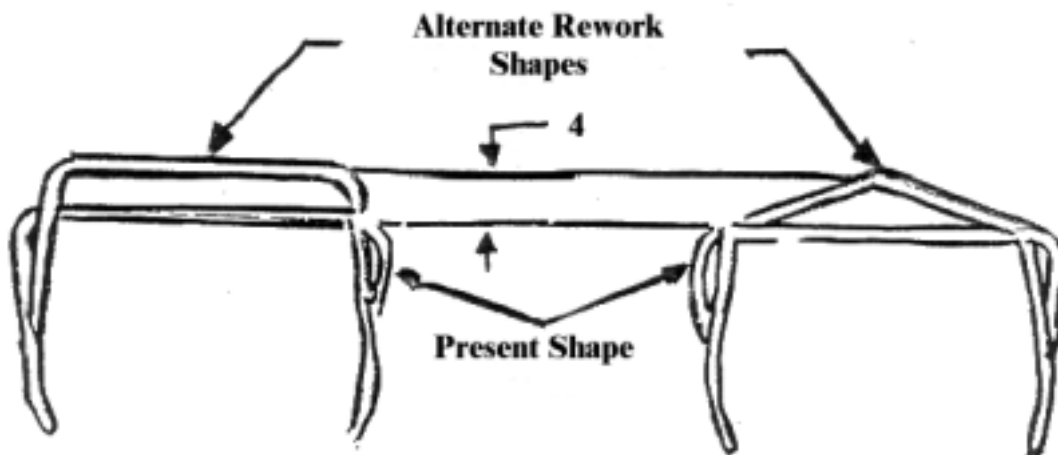


Figure 1